ADDENDUM NO. 4



MENDENHALL 'A' ROOF REPAIRS

FOR: FLORIDA STATE UNIVERSITY

June 30, 2017

This Addendum forms a part of the contract documents and modifies the drawings and specifications dated May 19, 2017 as noted below. Acknowledge receipt of the Addendums in the spaces provided on the proposal form. Failure to do so may subject Bidder to disqualification.

ITEM NO. 1: CLERESTORY WINDOW REPAIR:

Add:

Contractor to replace broken/cracked clerestory window panes (2) above the narrow low slope roof of Roof C, that have been sealed with sealant and painted over (brown paint) with new panes, size and thickness to match existing. (See photo attached) Seal the perimeter with silicone glazing, as required.

Contractor to provide unit cost to remove clerestory window panes and replace with new. \$__/ pane.

Add:

Contractor to carefully remove **two** section of clerestory window frames (4 panes in each section) above the northern end of Roof G. Remove the deteriorated wood blocking at the sill and replace with new pressure treated 2"x 4" blocking and new stainless steel 3/8" anchors bolts, counter sunk. Reinstall salvaged clerestory window frames into existing opening with new stainless steel anchors. Clean, prime and paint window frames and seal window frames and panes perimeter with premium silicone sealant, as detailed.

Clarification: Carefully remove and salvage the existing clerestory window screens. Complete work at windows as specified and reinstall screens with new stainless steel screws.


END OF ADDENDUM NO. 4


Attachments:

Partial Reduced Roof Plan Clerestory Window Detail

Photos





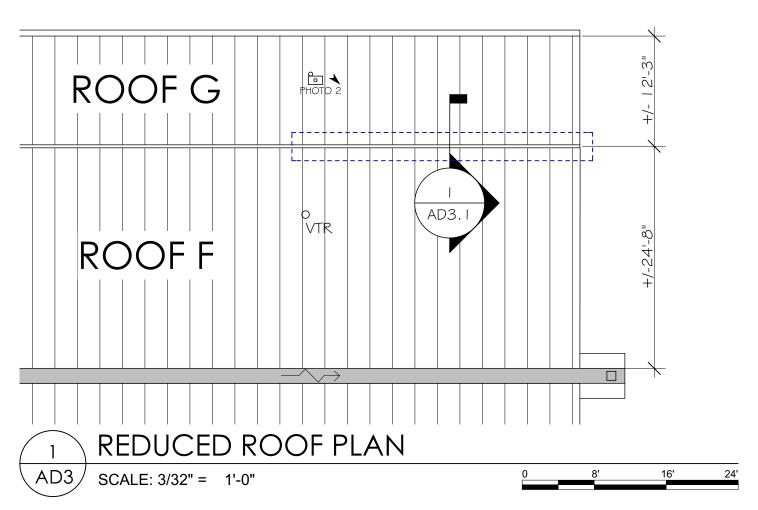

MENDENHALL BUILDING 'A' ROOF REPAIRS

AD4

FLORIDA STATE UNIVERSITY TALLAHASSEE, FL.

PROJ. NO. 126117

DATE 07/29/2017

DRAWN EA


CHECKED RB


APPROVED J5

REVISION


REVISION DATE



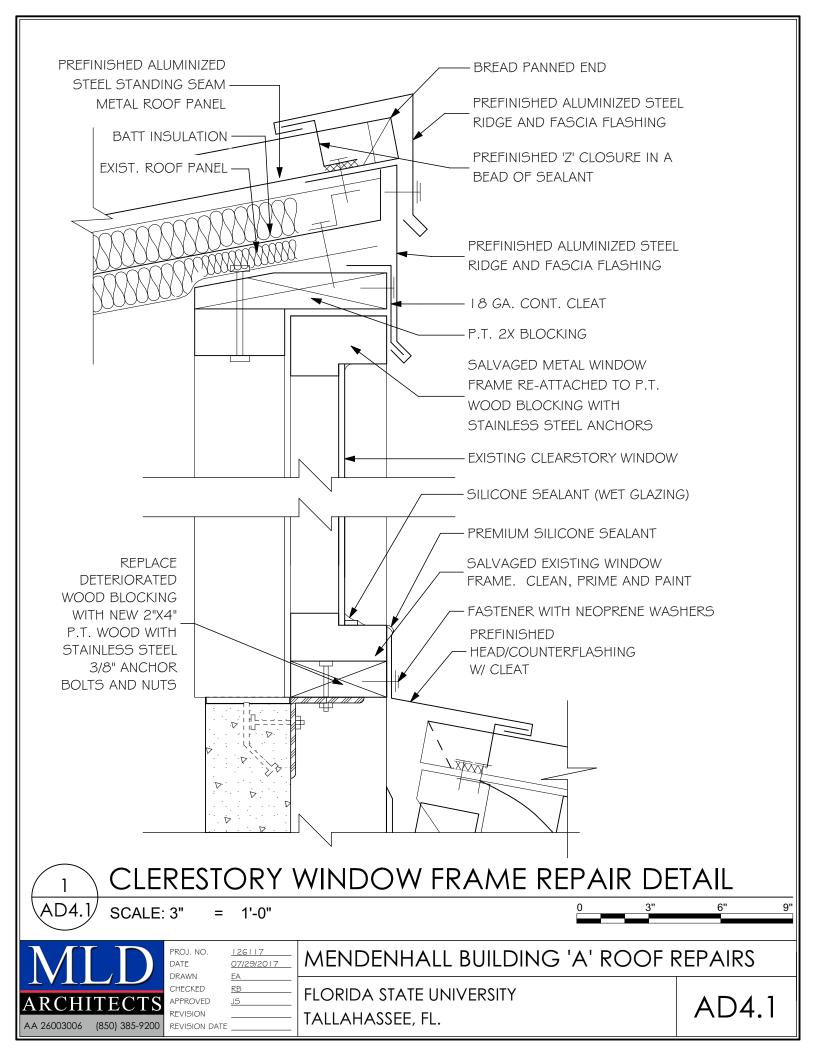

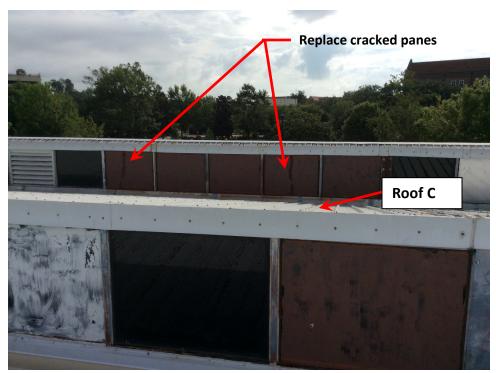

Addendum 4 – Photo #1

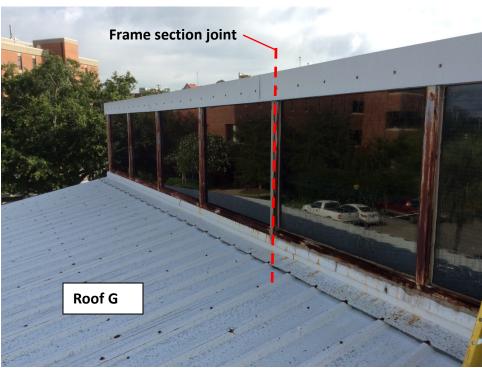

Addendum 4 – Photo #2